


# BCS3600<sup>ex</sup>-IS Hand-held scanner

## Accessories

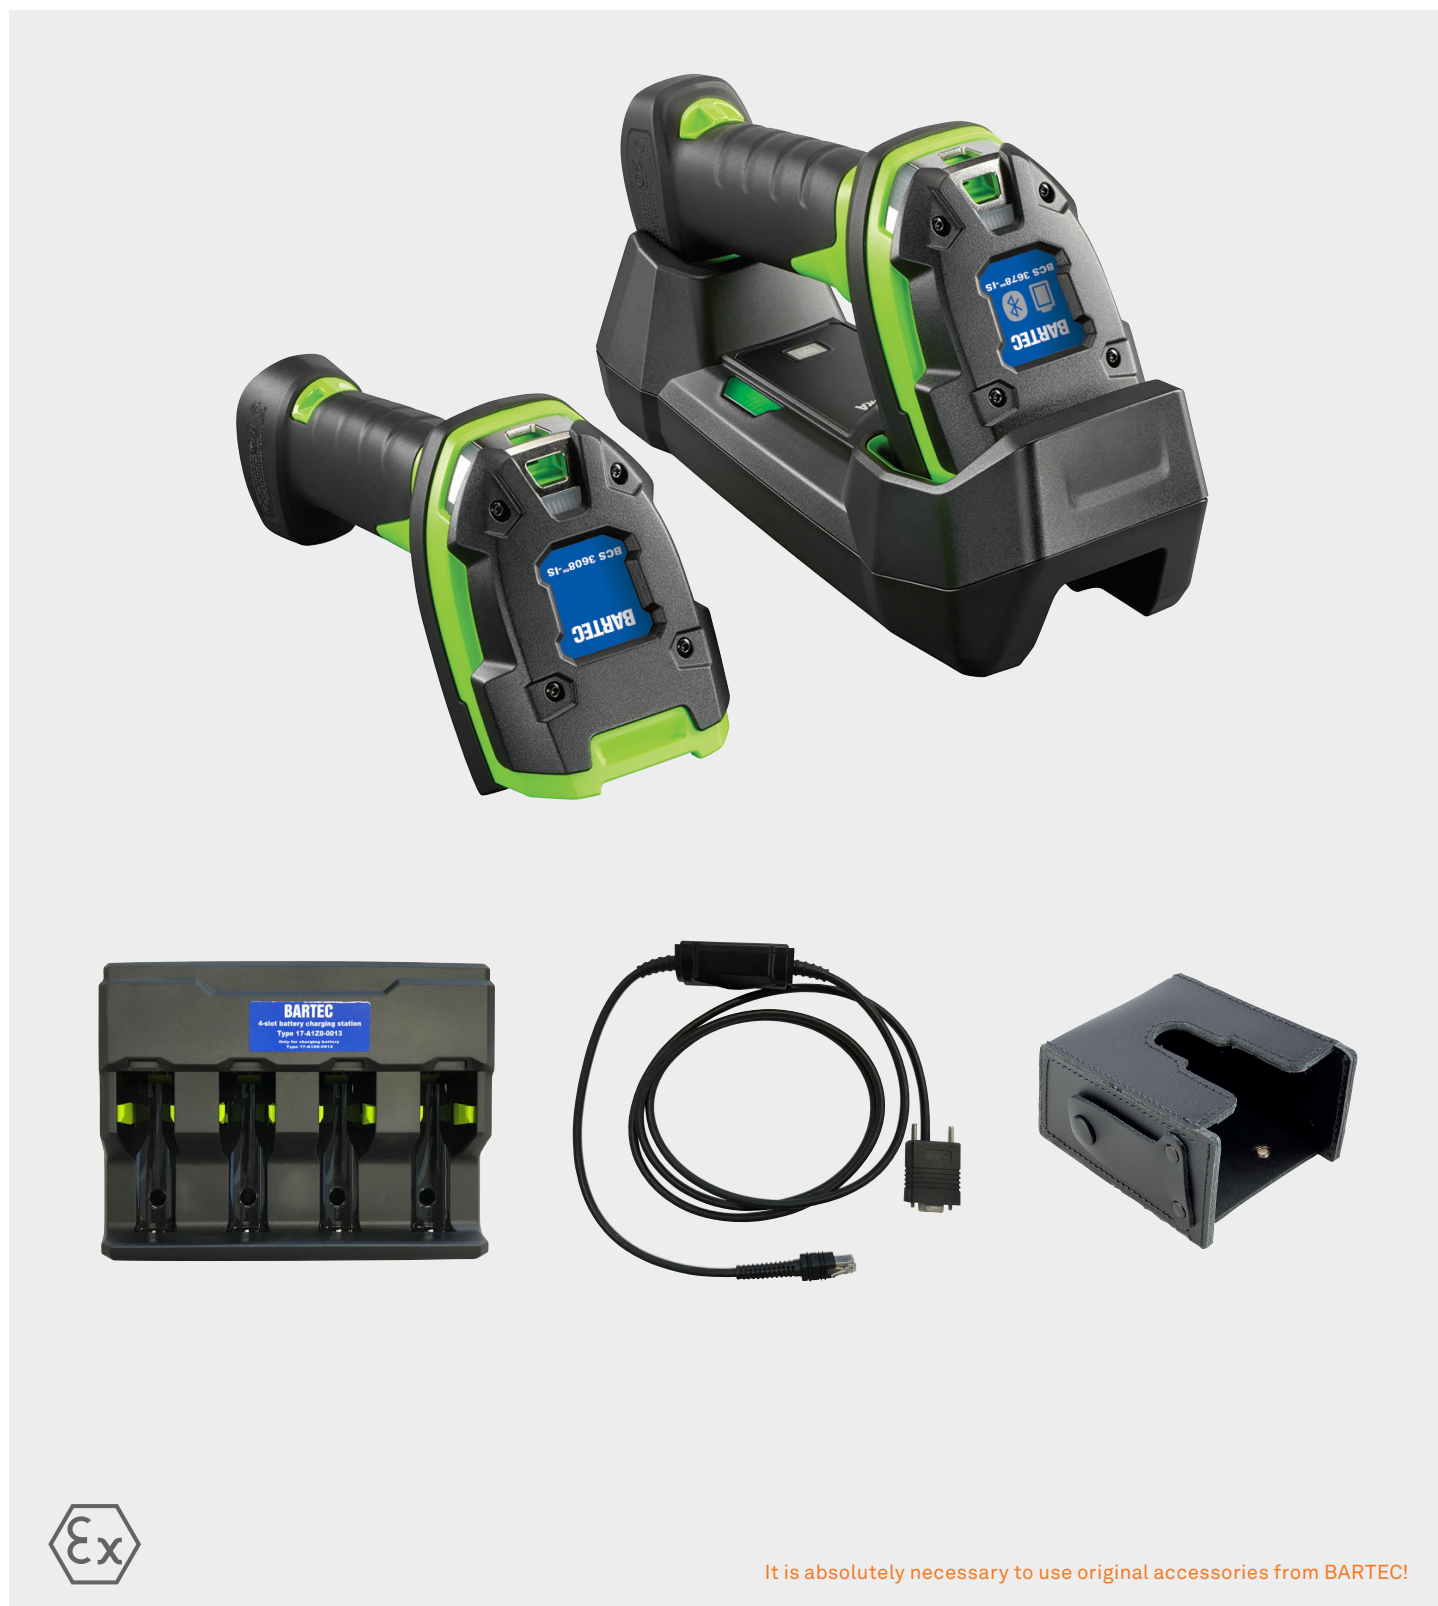

It is absolutely necessary to use original accessories from BARTEC!

## Accessories for use in hazardous areas

Accessories are approved for:

- ATEX: Zone 1/21 (EPS 18 ATEX 1 199 X + EPS 17 ATEX 1 177 X)
- IECEx: Zone 1/21 (IECEx EPS 18.0100X + IECEx EPS 17.0090X)
- UL: Zone 0/20 and Class I, II, III Division 1 (E3226123)



### Battery

Description	– for BCS3678 <sup>ex</sup> -IS Hand-held scanner – Lithium-Ion battery 3.6 V/2800 mAh (10.08 Wh) May only be changed and charged outside hazardous areas!
Order no.	17-A1Z0-0012



### Leather holster

Description	– for attachment to a belt or wall – Color: black
Order no.	17-A1Z0-0024



### Connecting cable

Description	– Connection between supply module and BCS3608 <sup>ex</sup> -IS Hand-held scanner	
Order no.	1.9 m (plain)	17-A1Z0-0015
	4.5 m (plain)	17-A1Z0-0016
	2.7 m (spiral)	17-A1Z0-0017

## Accessories for use outside hazardous areas



### 4-slot battery charging station

Description	<ul style="list-style-type: none"> <li>– for BCS3678<sup>EX</sup>-IS Hand-held scanner</li> <li>– input voltage: DC 12 V (50 W)</li> <li>– Charging indicator via LED</li> </ul>
Scope of delivery	4-slot battery charging station
Also required	(Not included in the delivery) <ul style="list-style-type: none"> <li>– Power supply with DC connecting cable (G7-A0Z0-0019)</li> <li>– AC power cable</li> </ul>
Order no.	17-A1Z0-0013



### Base station

Description	<ul style="list-style-type: none"> <li>– for BCS3678<sup>EX</sup>-IS Hand-held scanner</li> <li>– Input voltage: DC 12 V</li> <li>– Data synchronisation via Bluetooth, Supported interfaces (full functionality as specified by Zebra): USB + RS232</li> <li>– Charging the battery inserted in the hand-held scanner</li> <li>– Charging function and charging indicator via LED</li> <li>– can be mounted on wall or table</li> </ul> Operating mode: <ul style="list-style-type: none"> <li>– Point-to-Point (1x scanner paired with 1x base station - default setting)</li> <li>– Multipoint-to-Point (7x scanners can be paired with 1x base station)</li> </ul>
Scope of delivery	Base station
Also required	(Not included in the delivery) <ul style="list-style-type: none"> <li>– Power supply with DC connecting cable (G7-A0Z0-0019)</li> <li>– AC power cable</li> <li>– Connecting cable RS232 or USB (17-A1Z0-....)*</li> </ul> * Connecting cable absolutely necessary between power supply and base station. Power supply cannot be connected directly to the base station.
Order no.	17-A1Z0-0014



### Programming cable USB

Description	<ul style="list-style-type: none"> <li>– identical with Connecting cable USB</li> <li>– Programming BCS3608<sup>ex</sup>-IS via PC</li> <li>– Programming BCS3678<sup>ex</sup>-IS via PC and base station</li> <li>– 1.9 m (plain)</li> </ul>
Scope of delivery	Programming cable USB
Also required	(Not included in the delivery) <ul style="list-style-type: none"> <li>– Power supply with DC connecting cable (G7-A0Z0-0019)</li> <li>– AC power cable</li> <li>– Base station (when using the BCS3678<sup>ex</sup>-IS)</li> </ul>
Order no.	17-A1Z0-0020



### Connecting cable RS232

Description	<ul style="list-style-type: none"> <li>– for BCS3678<sup>ex</sup>-IS Hand-held scanner</li> <li>– Connection between PC and base station</li> <li>– Cable with terminal for 12 V power supply</li> </ul>
Scope of delivery	Connecting cable RS232
Also required	(Not included in the delivery) <ul style="list-style-type: none"> <li>– Power supply with DC connecting cable (G7-A0Z0-0019)</li> <li>– AC power cable</li> </ul>
Order no.	1.9 m (plain)                      17-A1Z0-0026 4.5 m (plain)                        17-A1Z0-0027



### Connecting cable USB

Description	<ul style="list-style-type: none"> <li>– identical with programming cable USB</li> <li>– for BCS3678<sup>ex</sup>-IS Hand-held scanner</li> <li>– Connection between PC and Base station</li> <li>– Cable with terminal for 12 V power supply</li> <li>– 1.9 m (plain)</li> </ul>
Scope of delivery	Connecting cable USB
Also required	(Not included in the delivery) <ul style="list-style-type: none"> <li>– Power supply with DC connecting cable (G7-A0Z0-0019)</li> <li>– AC power cable</li> </ul>
Order no.	17-A1Z0-0020



### Power supply with DC connecting cable

Description	<ul style="list-style-type: none"> <li>– for 4-slot battery charging station and base station</li> <li>– Input voltage: AC 100 to 240 V</li> <li>– Output voltage: DC 12 V/4.16 A/50 W</li> </ul>
Order no.	G7-A0Z0-0019



**AC power cable**

Description	– 3-wire – country-specific	
Order no.	Version: US + Canada	G7-A0Z0-0024
	Version: EU + APAC	G7-A0Z0-0026
	Version: Taiwan	G7-A0Z0-0027
Please purchase the required country specific cables (with plug IEC-60320-C13) in the respective country!		



**Special tool for lock nut**

Description	– for BCS3678 <sup>ex</sup> Hand-held scanner – open and lock the safety lock nut on the battery compartment – 5 pieces	
Order no.	G7-A0Z0-0031	